




Gi07-201710-10 Maj : 05 / 11 /2020

EN355:2002 FA3000035 - FA3000045 - FA3010015 - FA3010020 - FA3010115 - FA3010120 - FA3010215 - FA3010220 - FA3010315 - FA3010320
 FA3020015 - FA3030015 - FA3030020 - FA3030115 - FA3030120 - FA3030215 - FA3030220 - FA3030315 - FA3030320 - FA3030418 - FA3030510 - FA3030515 - FA3030520
 FA3030620 - FA3030720 - FA3030820 - FA3030920 - FA3040018 - FA3040118 - FA3040210 - FA3040215 - FA3040315 - FA3040415 - FA3040515 - FA3040620 - FA3050015
 FA3050020 - FA3050115 - FA3050120 - FA3050215 - FA3050220 - FA3050315 - FA3050320 - FA3051120 - FA3051212 - FA3051220 - FA3051320 - FA3051420 - FA3060010
 FA3060015 - FA3061015 - FA3061420 - FA3062015 - FA3062115 - FA3070020 - FA3070120 - FA3070220 - FA3070320 - FA3071120 - FA3071220 - FA3071320 - FA3072220 -
 FA3072320 - FA3080015 - FA3081015 - FA3082015 - FA3082115 - FA3062215 - FA3090020 - FA30100020

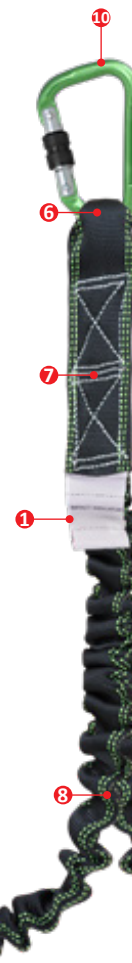

Supported by the product's user manual, as well as the inspection log; specific equipment and measuring devices not required. Look over and touch each component of the product in order to detect faults. If defects are detected at any one of the below control points, the product must absolutely not be reused and must be replaced with a compliant product. The use of this sheet for periodic inspection is reserved for competent persons.

Inspect the visual aspect of the product; the device must be checkable.

- 1 **Fall indicator (according to the model):** *Before each use, inspect your energy absorber. If the « **NOT OK** » sign is visible on the label, it means that your equipment has arrested a fall and the product has not to be reused.*
- 2 **Stretching indicator (according to the model):** *Specific Models : FA30 90020 – FA3010020: Check that the stretching of the lanyard does not exceed the maximum value indicated by the tag.*
- 3 **Energy Absorber (according to the model) :** *Check the condition of the absorber's transparent protective sleeve, the sleeve must not be deformed. Check visually that the webbing of the absorber is not torn because of a fall.*

Specific Models : FA3072220 – FA3072320 – FA3082015 (To check the energy absorber, open it's protective bag).

Specific Models : FA3090020 – FA30100020 (Energy absorbing system is part of the webbing).
- 4 **Absorber's tips (according to the model) :** *Check the condition of the absorber's tips. no defects such as wear, cuts, burns, deformations must be present.*
- 5 **I.D label:** *Check that the marking label is present and readable.*
- 6 **Lanyard's tips:** *Check the conditions of lanyard's tips, no defects such as wear, cuts, burns or deformations must be present.*
- 7 **Lanyard's stitchings / Splices :** *Check the condition of the stitchings and the splices at each end of the webbing, kernmantle or twisted rope, no defects such as wear, cuts, burns, deformations must be present. Check that the protective sleeves are present on the splices or on the stitchings (only the kernmantle and the twisted ropes are protected at each end by heatshrink protection sleeves.*
- 8 **Webbing / Kernmantle / Twisted lanyard:** *Check the condition of the webbing / kernmantle rope / twisted rope on it's entire length, no defects such as wear, cuts, burns, deformations must be present. For elastic webbing lanyards, check that the elastic is still operating.*
- 9 **Metal rings (according to the model) :** *Check the condition of the metal rings, no defects such as wear, cuts or oxidation must be present.*
- 10 **Connectors (according to the model) :** *Please refer to connectors's inspection guide*

Overall Condition : *Evaluate the overall condition of the product according of the above checkpoints, and the visual aspect of the product .*